



# 200-EGA Converter Mounts On Top Of The Display Controller Card Cage.

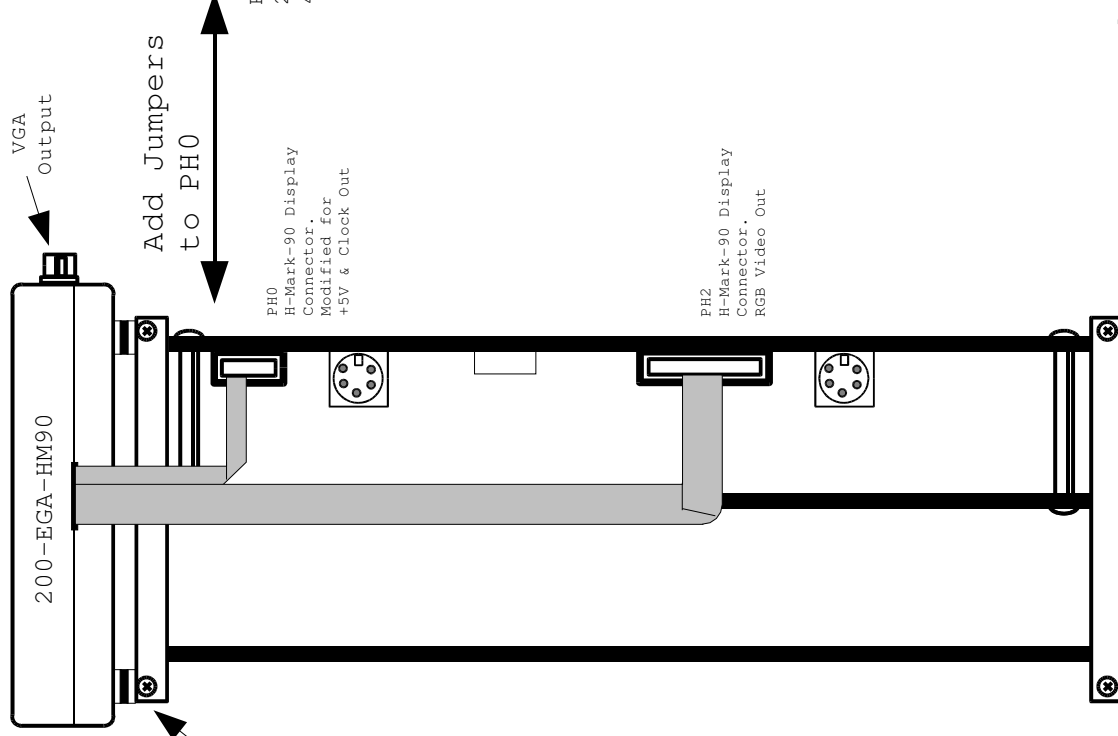

Clean Rails with alcohol and attach with velcro tape.

## Graphics Controller Board: GDC-68E2 (Solder Side)

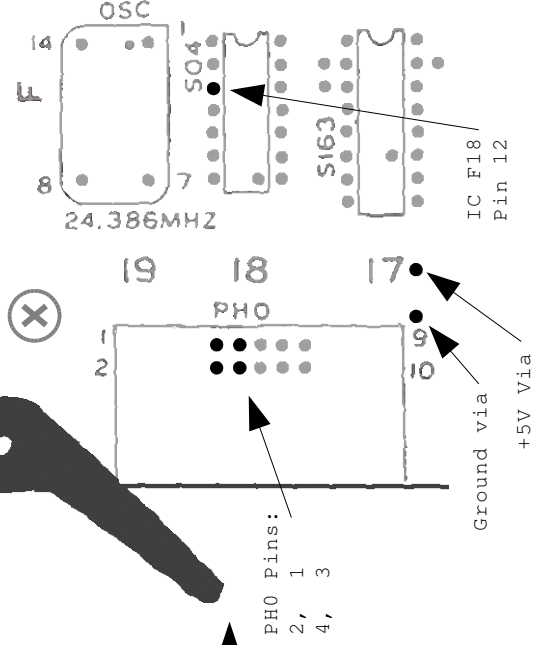


### Install Three Jumpers:

Remove the double board controller assembly from the card cage using static-safe procedures.

Using low-power, electronic-grade soldering techniques install the following jumpers, provided with the 200-EGA-HM90:

- 1) Jump PH0 pin 1 to IC F18 pin 12 using the heat-shrunked 39 ohm, 1/8 W resistor.
- 2) Jump PH0 pin 2 to the Ground Via using the blue #28 solid Cu. wire.
- 3) Jump PH0 pins 3 & 4 to the +5V Via using the red #28 solid Cu. Wire.

Return the assembly to the card cage and install the 200-EGA-HM90.

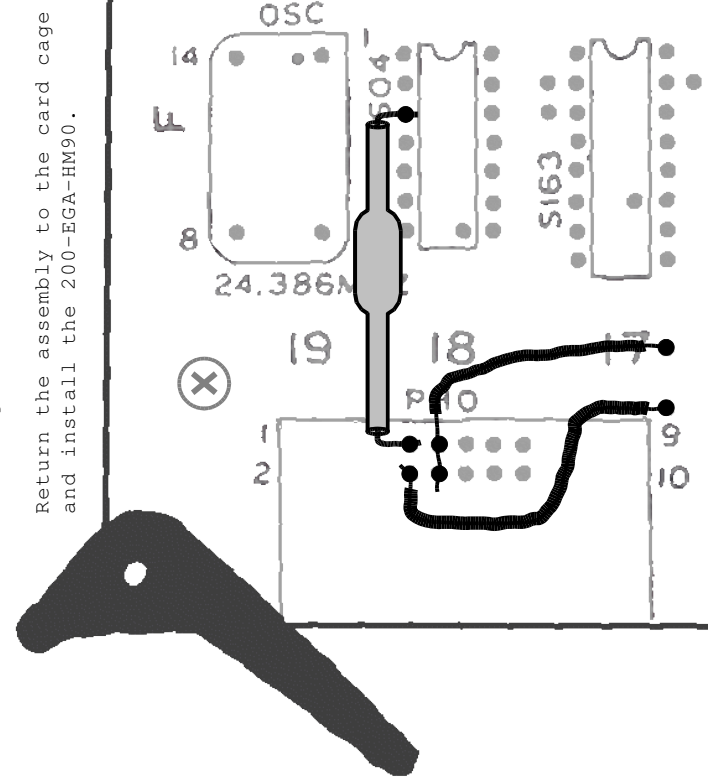

Copyright © 2005, by Video Widgets

### Video Widgets

TITLE:

**200-EGA-HM90  
VGA Converter for H-Mark 90  
Installation Instructions.**

VERSION:  
01

APPROVED BY:

DATE:

PN:

200-EGA-HM90-1

BY:

D.Lee

DATE:

12/09/05

SHEET:

1 / 1